


# A50

A50-SLSA4-95-M42

一体型 3°

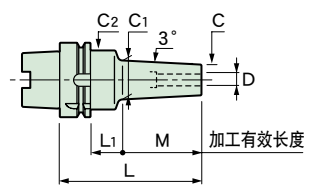

**■标准附属品**  
●冷却液导管(固定式)→P.206

**■备考**  
●可对应可动式冷却液导管→P.206

**■注意事项**  
●刀具安装...插入刀具时,请务必将刀具插入比安全记号更深的位置。  
●A50M 倒扣部分尺寸同规格不同。请注意是否同 ATC 臂发生干涉。

HEATROBO电磁 1200S (HRD-01S-230AS)  
电磁式加热器对应表

[○] 可加热 [×] 不可加热


型号	φD	φC	t	L	M	L <sub>1</sub>	φC <sub>1</sub>	φC <sub>2</sub>	H	h	Kg	N	S	缩略图			
<b>A50-SLSA 3- 95-M42</b>	3	6	1.5	95	42	27	10.4	25	9	71	0.5	5.8	9.1	○			
-125-M42				125						57					101	0.6	6.5
<b>-SLRA 3- 75-M22</b>	3	7.5	2.25	75	22	27	9.8	25	9	51	0.5	6.2	2.8	○			
- 95-M42				95						42					11.9	71	6.6
-125-M42				125						57		101	0.6		7.3	6	
<b>A50-SLSA 4- 95-M42</b>				4						7		1.5	95		42	27	11.4
-125-M42	125	57	101		0.6	7.7	7.9										
<b>-SLRA 4- 75-M22</b>	4	10	3	75	22	27	12.3	25	12	51	0.5	6.3	1.7	○			
- 95-M42				95						42					14.4	71	7
-125-M42				125						57		101	0.6		7.7	3.8	
<b>A50-SLSA 6- 95-M42</b>				6						9		1.5	95		42	27	13.4
-125-M42	125	57	101		0.6	8	5.6										
<b>-SLRB 6- 75-M22</b>	6	14	4	75	22	27	16.3	32	18	50	0.5	7.2	1	○			
- 95-M42				95						42					18.4	70	0.6
-125-M42				125						57		100	0.7		10.2	1.9	
<b>A50-SLSA 8- 95-M42</b>				8						11		1.5	95		42	27	15.4
-125-M42	125	57	101		0.6	11.8	4.4										
<b>-SLRB 8- 75-M22</b>	8	18	5	75	22	27	20.3	32	24	50	0.6	7.9	0.7	×			
- 95-M42				95						42					22.4	70	10.5
-125-M42				125						57		100	0.8		11.8	1.5	
<b>A50-SLSA10- 95-M42</b>				10						13		1.5	95		42	27	17.4
-125-M42	125	57	101		0.6	12.1	3.7										
<b>-SLRB10- 75-M22</b>	10	22	6	75	22	27	24.3	32	30	50	0.6	8.3	0.6	×			
- 95-M42				95						42					26.4	70	11.9
-125-M42				125						57		100	0.8		13.3	1.3	
<b>A50-SLRB12- 75-M22</b>				12						26		7	75		22	27	28.3
- 95-M42	95	42	30.4		72	0.8	6.3	0.6									
-125-M42	125	57	98		1	22.9	0.8										
<b>A50-SLRB16- 75-M22</b>	16	32	8	75	22	27	34.3	42	32	52	0.7	6.3	0.4	○			
-105-M22				105						57					78	1	19
<b>A50M-SLRB20- 75-M22</b> *1	20	38	9	75	22	27	40.3	49	40	51	0.8	6.4	0.3	○			
-105-M22*1				105						57					76	1.2	15.1

\*1 使用电磁5000加热器对SLRB20加热时,所使用加热线圈号码不同。请使用加热线圈No.4进行加热。


MAKINO J J3 / L2

**φ3**


**A50-SLSA3-95-M42**

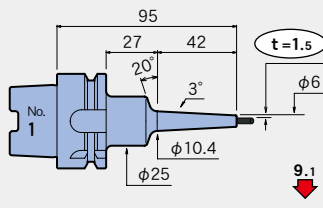


**A50-SLSA3-125-M42**

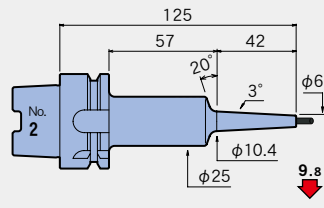


**A50-SLRA3-75-M22**

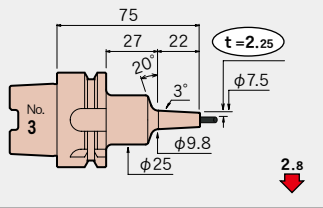

**A50-SLRA3-95-M42**

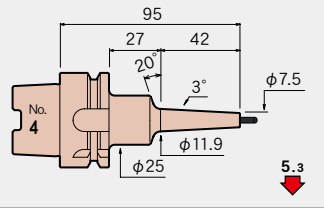


**A50-SLRA3-125-M42**

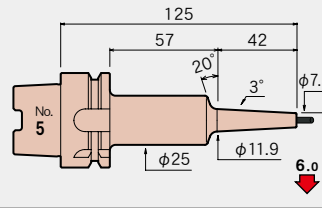


**φ4**


**A50-SLSA4-95-M42**

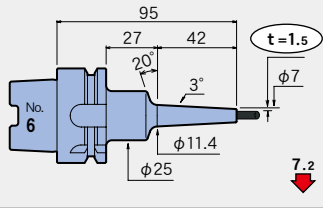


**A50-SLSA4-125-M42**

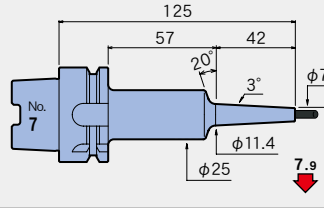


**A50-SLRA4-75-M22**

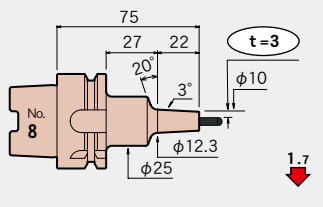

**A50-SLRA4-95-M42**

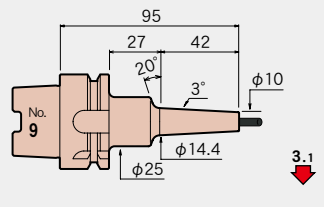


**A50-SLRA4-125-M42**

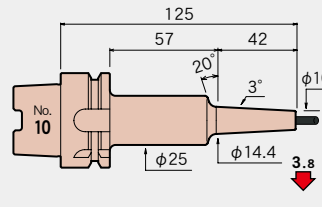


**φ6**


**A50-SLSA6-95-M42**

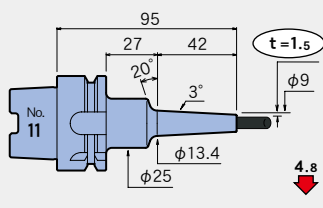


**A50-SLSA6-125-M42**

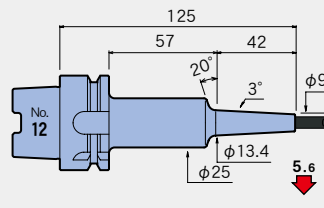


**A50-SLRB6-75-M22**

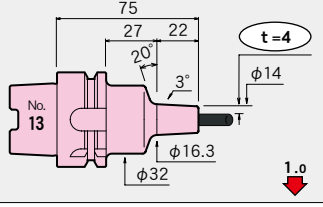

**A50-SLRB6-95-M42**

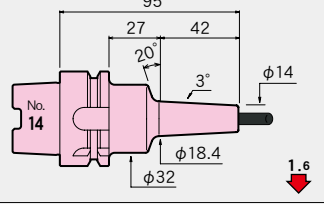


**A50-SLRB6-125-M42**

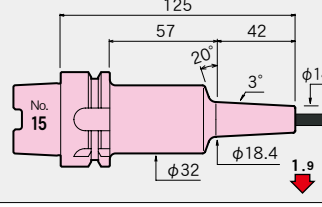


特点  
加热装置  
一体型 3°  
一体型 CURVE  
一体型系列  
2 体型系列  
UNO  
强力型 热敏刀磨  
Z  
直柄延长杆  
相关商品  
周边机器  
技术资料

φ8


**A50-SLSA8-95-M42**

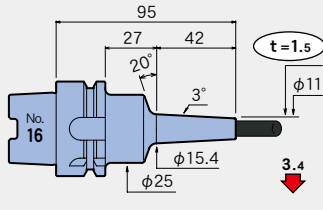


**A50-SLSA8-125-M42**

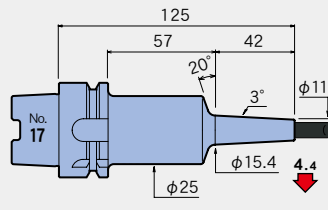


**A50-SLRB8-75-M22**

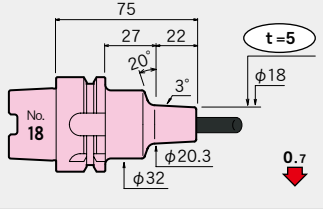

**A50-SLRB8-95-M42**

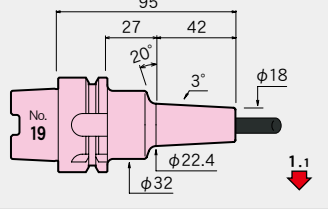


**A50-SLRB8-125-M42**

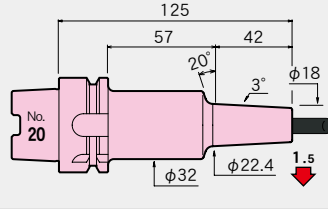


φ10


**A50-SLSA10-95-M42**

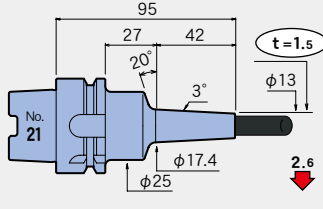


**A50-SLSA10-125-M42**

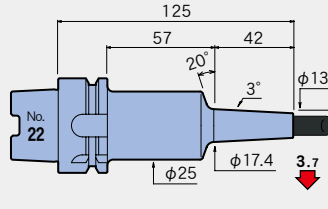


**A50-SLRB10-75-M22**

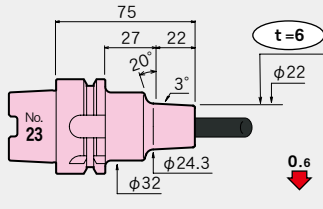

**A50-SLRB10-95-M42**

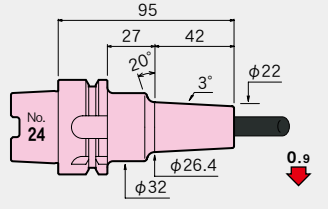


**A50-SLRB10-125-M42**

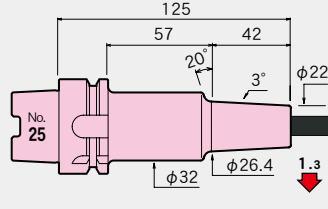


φ12


**A50-SLRB12-75-M22**

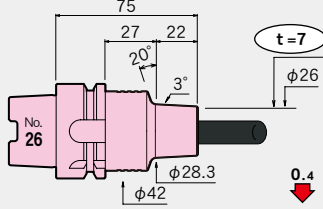

**A50-SLRB12-95-M42**

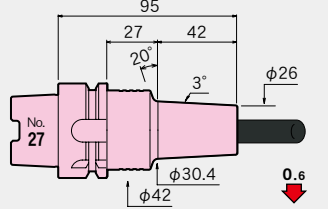


**A50-SLRB12-125-M42**

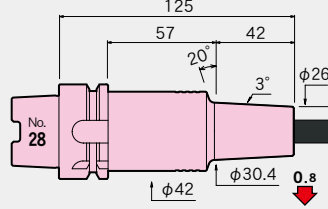


φ16

**A50-SLRB16-75-M22**

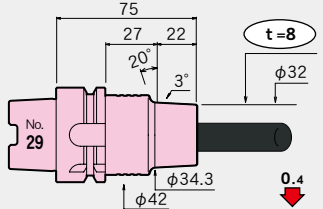


**A50-SLRB16-105-M22**

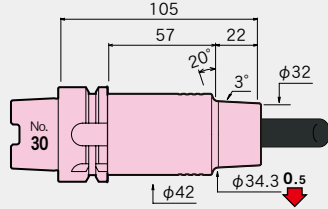

φ20

**A50M-SLRB20-75-M22**

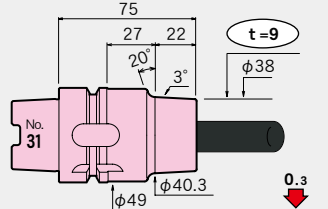

**A50M-SLRB20-105-M22**

