


A40

A40-SLSA4-85-M42

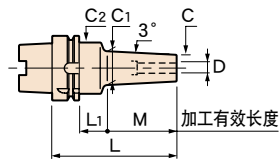

■标准附属品
●冷却液导管(固定式)→P.206

■备考
●可对应可动式冷却液导管→P.206

■注意事项
●刀具安装…插入刀具时,请务必将刀具插入比安全记号更深的位置。

安全记号

壁厚 t

H 最短夹持长度

h 刀具最大插入长度

HEATROBO电磁 1200S (HRD-01S-230AS)
电磁式加热器对应表

[○] 可加热 [×] 不可加热

型号	φD	φC	t	L	M	L1	φC1	φC2	H	h	kg	N	S	省略图	
A40-SLSA3- 60	3	6	1.5	60	22	18	8.3	20	9	44	0.2	1.3	4.8	○	1
- 65-M22				65		23				25				0.3	3
- 85-M42				85	42	10.4	64	3.2		9.1	○	3			
-100-M42				100	38	78	3.3	9.3		○	4				
-SLRA3- 65-M22	3	7.5	2.25	65	22	23	9.8	25	9	44	0.3	3	2.7	○	5
- 85-M42				85						42				11.9	64
-SLFB3- 65-M22	3	9.5	3.25	65	22	23	11.8	25	9	44	0.3	3	1.2	○	7
- 85-M42				85						42				13.9	64
A40-SLSA4- 60	4	7	1.5	60	22	18	9.3	20	12	44	0.2	1.4	3.8	○	9
- 65-M22				65		23				25				0.3	3.1
- 80				80	42	18	11.4	20		64	0.2	1.4	7.5	○	11
- 85-M42				85	23	25	0.3	3.4		7.1	○	12			
-100-M42				100	38	78	3.5	7.4		○	13				
-SLRA4- 65-M22	4	10	3	65	22	23	12.3	25	12	44	0.3	3.1	1.7	○	14
- 85-M42				85						42				14.4	64
-SLFB4- 65-M22	4	12	4	65	22	23	14.3	25	12	44	0.3	3.2	1.3	○	16
- 85-M42				85						42				16.4	64
A40-SLSA6- 65-M22	6	9	1.5	65	22	23	11.3	25	18	44	0.3	3.2	2.3	○	18
- 80				80						42				18	13.4
- 85-M42				85	23	25	64	0.3		3.9	4.8	○	20		
-100-M42				100	38	78	4	5.1		○	21				
-SLRA6- 60	6	12	3	60	22	18	14.3	26	18	39	0.3	1.4	1.3	○	22
- 65-M22				65						23				25	44
- 85-M42				85	42	16.4	64	3.9		2.4	○	24			
-SLFB6- 70-M22	6	14	4	70	22	28	16.3	32	18	48	0.4	4.1	1	○	25
- 90-M42				90						42				18.4	68
A40-SLSA8- 65-M22	8	11	1.5	65	22	23	13.3	25	24	44	0.3	3.2	1.6	○	27
- 85-M42				85						42				23	15.4
-100-M42				100	38	78	4.4	3.8		○	29				
-SLRA8- 65-M22	8	14	3	65	22	23	16.3	25	24	44	0.3	3.2	1.1	○	30
- 85-M42				85						42				18.4	64
-SLFB8- 70-M22	8	18	5	70	22	28	20.3	32	24	48	0.4	4.1	0.7	×	32
- 90-M42				90						42				22.4	68



型号	ϕD	ϕC	t	L	M	L ₁	ϕC_1	ϕC_2	H	h	Kg	N	S	缩略图	特点
A40-SLSA10- 65-M22	10	13	1.5	65	22	23	15.3	25	30	44	0.3	3	1.2	○	34
- 85-M42				85	42		17.4			64		4.6	2.6		
- 90				90	28	26	1.9								
-100-M42				100	38	25	78	4.7	3						
-SLRA10- 65	10	16	3	65	22	23	18.3	26	25	44	0.3	1.6	0.9	○	38
- 65-M22												25	30		
- 90-M42				90	42	28	20.4	32	69	0.4		5.4	1.5		
-SLFB10- 70-M22	10	22	6	70	22	28	24.3	32	30	48	0.4	3.9	0.6	×	41
- 90-M42				90	42		26.4			68		0.5	5.6		
A40-SLSA12- 65-M22	12	15	1.5	65	22	23	17.3	25	30	44	0.3	3.3	1.1	○	43
- 90-M42				90	42		28			19.4		32	68		
-SLRA12- 65-M22	12	20	4	65	22	23	22.3	25	30	44	0.3	3.3	0.8	○	45
-SLFB12- 70-M22	12	26	7	70	22	28	28.3	32	30	48	0.4	4.2	0.6	×	46
A40-SLRA16- 65-M22	16	26	5	65	22	23	28.3	33.5	32	43	0.4	2	0.5	○	47
A40-SLRA20- 70-M50	20	32	6	70	50	-	33.5	-	38	48	0.4	2.4	0.6	○	48




MAKINO


N2-5AX




φ3





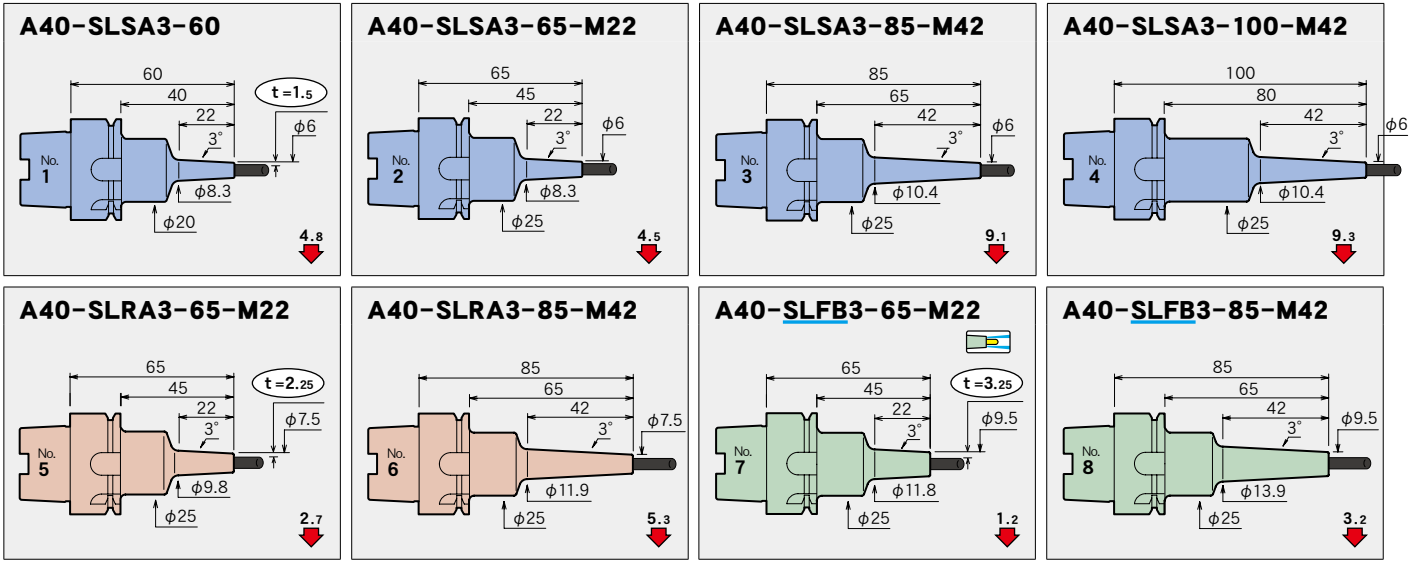


φ4







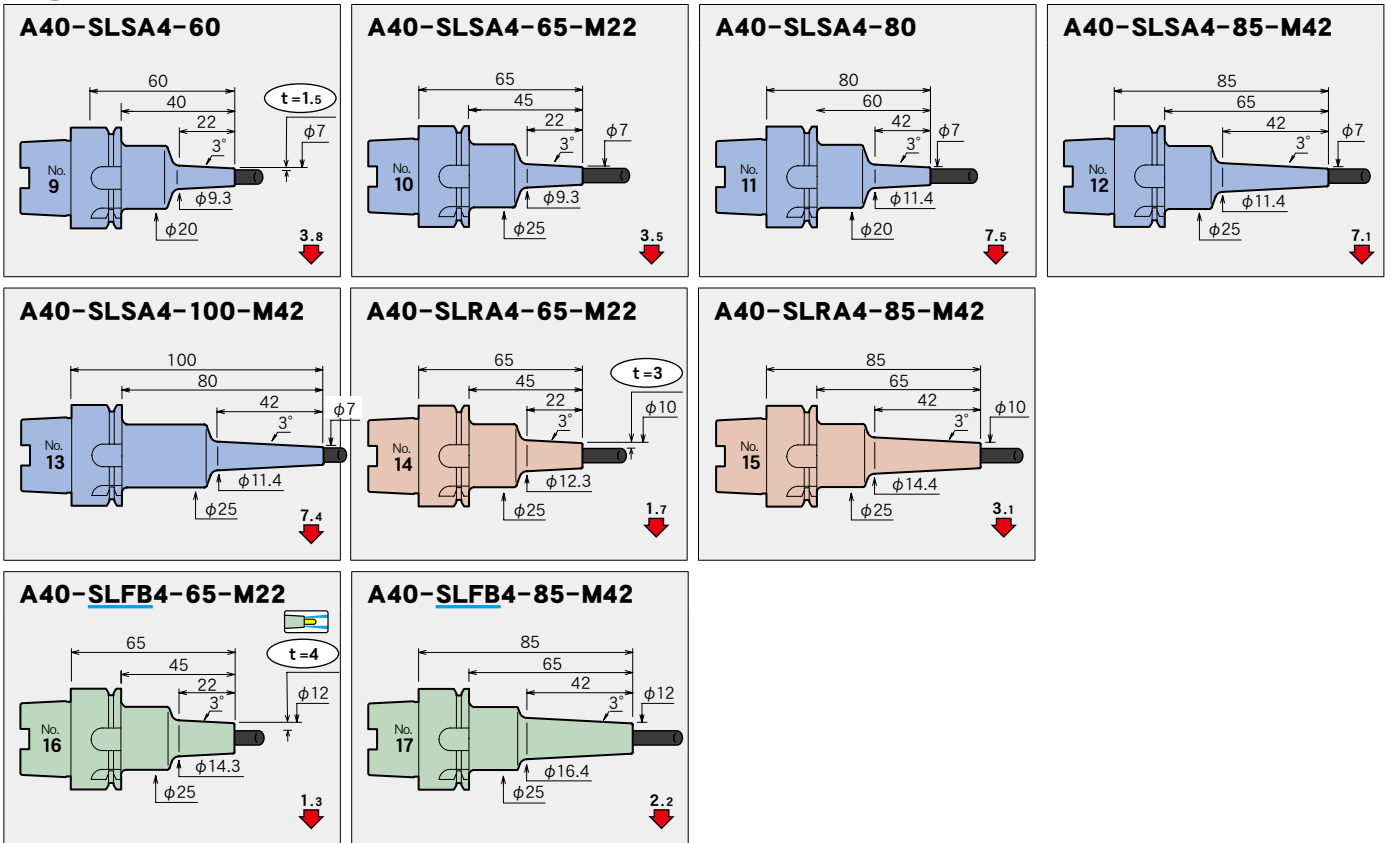


φ6







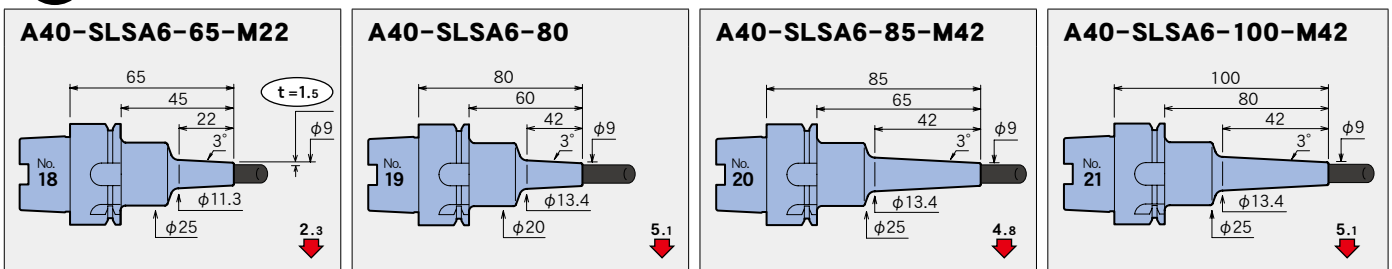


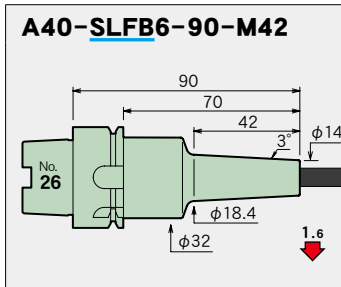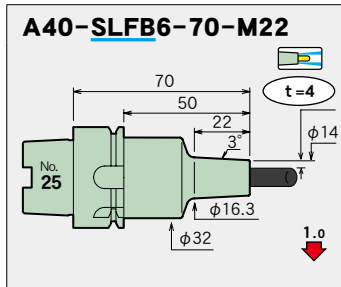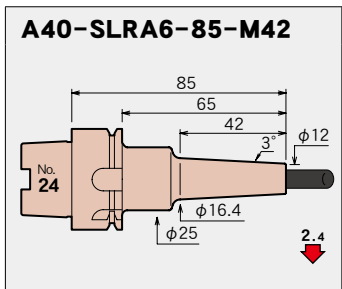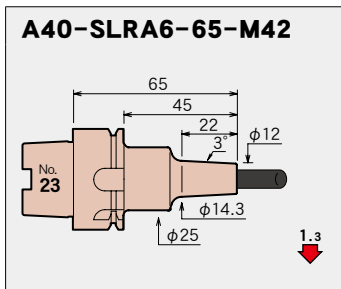
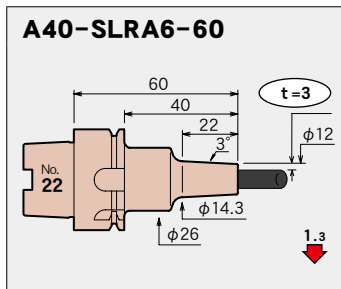


φ 8

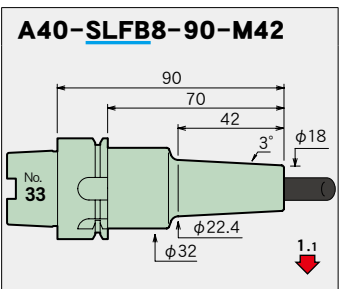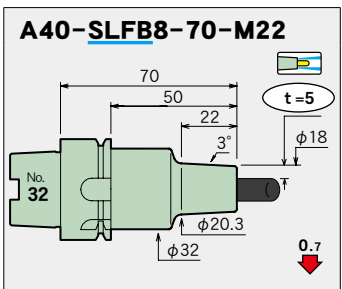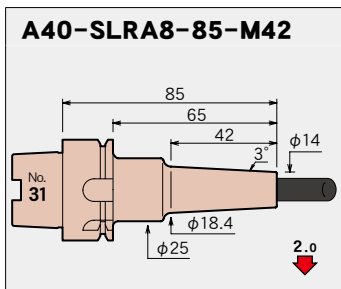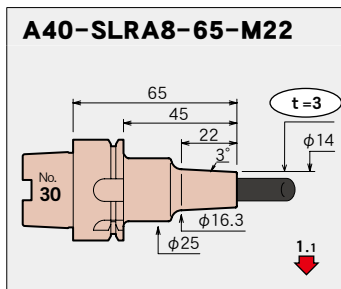
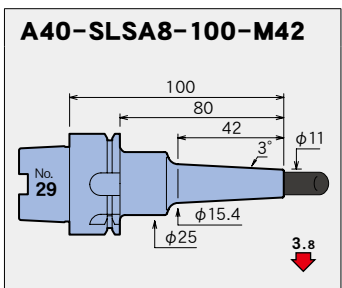
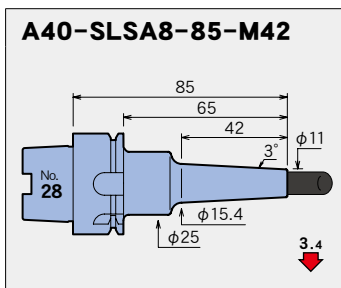
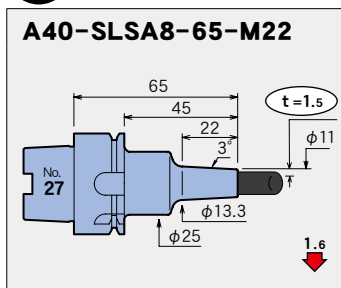


φ 10

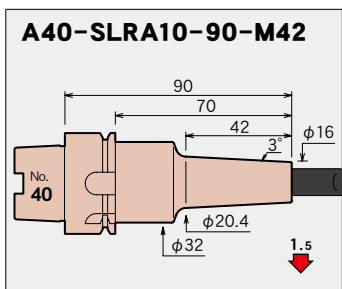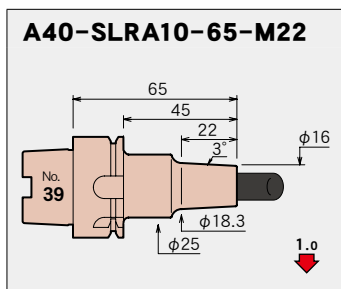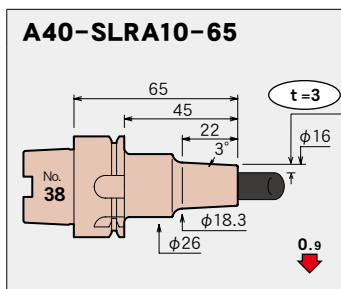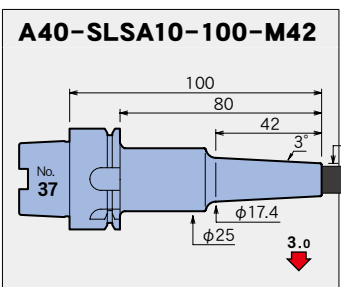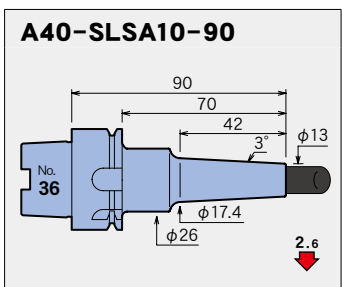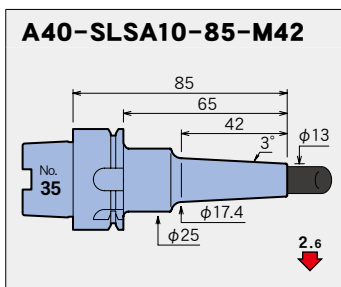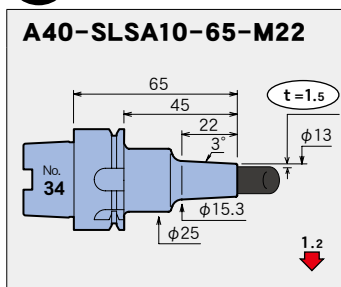


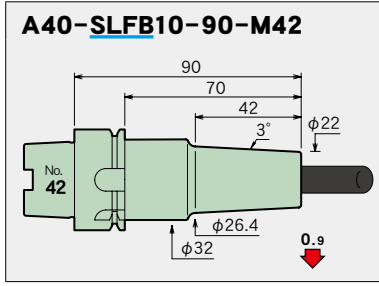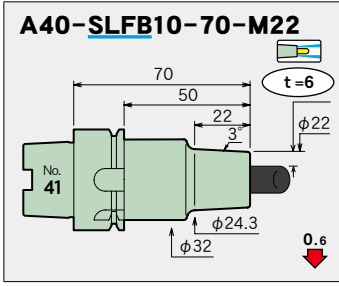

φ 12

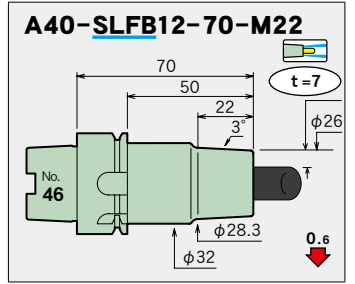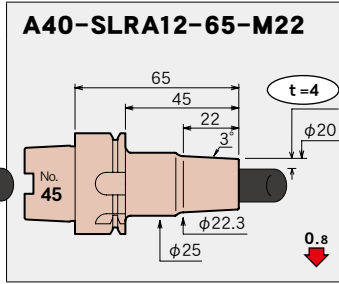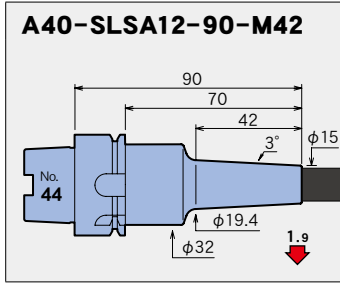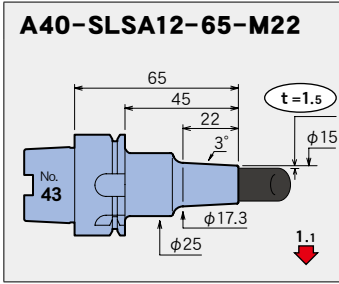

φ 16

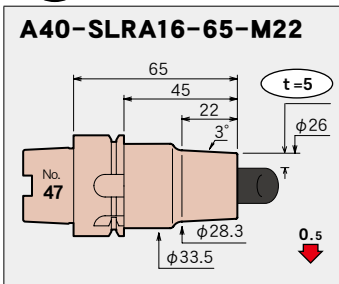

φ 20

